

XBA-CEK8(CZK4+EUR4) Option Switch Settings


Supported bill CZK 100, 200, 500, 1000 4bills
€ 5, 10, 20, 50 4bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
	Reject CZK 100 & 200	ON							
★	Accept CZK 100 & 200	OFF							
	Reject CZK 500 & 1000		ON						
★	Accept CZK 500 & 1000		OFF						
	Reject € 5 & 10			ON					
★	Accept € 5 & 10			OFF					
	Reject € 20 & 50				ON				
★	Accept € 20 & 50				OFF				
	Reject € 5(2002) & 10(2002)				ON				
★	Accept Normal				OFF				
	Disable Bill Reject 4 Times BA Stop By 30 Sec					ON			
★	Enable Bill Reject 4 Times BA Stop By 30 Sec					OFF			
	Stack Banknote when Power-up						ON		
★	Reject Banknote when Power-up						OFF		
	Reserved							ON	
★	Reserved							OFF	

★ Manufacture setting

Note: After setting dip switch of the credit pulses, you should reset the bill acceptor again.

This dip switch is located at the side of XBA.

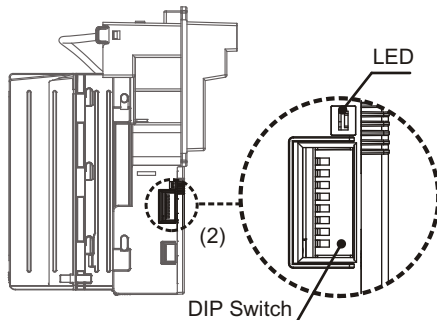

Currency Assign Data

Interface Bill value	ICT004U	Parallel A3	ICT104V	Pulse	MDB
BV1	CZK 100	CZK 100	CZK 100	CZK 100	CZK 100
BV2	CZK 200	CZK 200	CZK 200	CZK 200	CZK 200
BV3	CZK 500	CZK 500	CZK 500	CZK 500	CZK 500
BV4	CZK 1000	CZK 1000	CZK 1000	CZK 1000	CZK 1000
BV5	€ 5		€ 5	€ 5	€ 5
BV6	€ 10		€ 10	€ 10	€ 10
BV7	€ 20		€ 20	€ 20	€ 20
BV8	€ 50		€ 50	€ 50	€ 50

XBA-CEK8(CZK4+EUR4) (Pulse/MDB/ICT104U/GPT/ICT104V)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
	Inhibit Active HIGH	ON							
★	Inhibit Active LOW	OFF							
	Reserved		ON						
★	Reserved		OFF						
	Reserved			ON					
★	Reserved			OFF					
	Reserved				ON				
★	Reserved				OFF				
	Pulse Mode	MDB Mode			ICT104V Mode				
★	Credit-Pulse Normal HIGH	Scaling Factor (SF) = 100 Decimal Point Position (DPP) = 2			Connect with coin changer	ON			
	Credit-Pulse Normal LOW	Scaling Factor (SF) = 1 Decimal Point Position (DPP) = 0			Connect with ICT VCCS converter board	OFF			
★	Pulse Mode						ON		
	Other Mode						OFF		
	Pulse Mode	Other Mode							
★	1 pulse / € 5	MDB Mode						OFF	OFF
	5 pulses / € 5	GPT Mode						OFF	ON
	10 pulses / € 5	ICT104U Mode						ON	OFF
	25 pulses / € 5	ICT104V Mode						ON	ON

★ Manufacture setting

Note: 1. After setting dip switch of the credit pulses, you should reset the bill acceptor again.
2. Calibraion card is not needed.

This dip switch is located on the CPU board, remove the CPU board cover first.

