


XBA-EUR6

XBA Option Switch Settings(Pulse/MDB/ICT104U/Parallel A3/ICT104V)

Supported bill € 5, 10, 20, 50, 100, 200 6bills.

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reject € 5	ON							
★	Accept € 5	OFF							
★	Reject € 10		ON						
★	Accept € 10		OFF						
★	Reject € 20			ON					
★	Accept € 20			OFF					
★	Reject € 50				ON				
★	Accept € 50				OFF				
★	Reject € 100(2019) & 200(2019)				ON				
★	Accept € 100(2019) & 200(2019)				OFF				
★	Disable Bill Reject 4 Times BA Stop By 30 Sec					ON			
★	Enable Bill Reject 4 Times BA Stop By 30 Sec					OFF			
★	Stack Banknote when Power-up							ON	
★	Reject Banknote when Power-up							OFF	
	Reserved								ON
★	Reserved								OFF

This dip switch is located at the side of XBA.

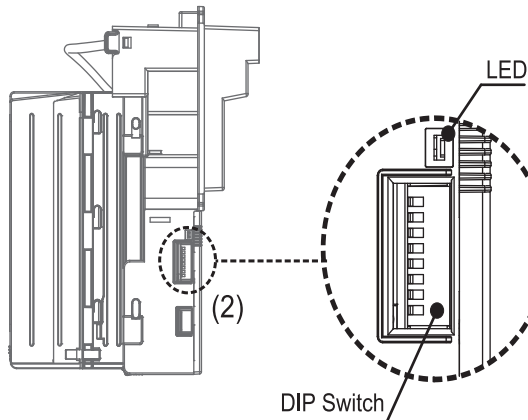


Currency Assign Data

Interface Bill value	ICT104U	Parallel A3	ICT104V	Pulse	MDB
BV1	€ 5	€ 5	€ 5	€ 5	€ 5
BV2	€ 10	€ 10	€ 10	€ 10	€ 10
BV3	€ 20	€ 20	€ 20	€ 20	€ 20
BV4	€ 50	€ 50	€ 50	€ 50	€ 50
BV5	€ 100		€ 100	€ 100	€ 100
BV6	€ 200		€ 200	€ 200	€ 200

XBA-EUR6 (Pulse/MDB/ICT104U/Parallel A3/ICT104V)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8	
★	Inhibit Active HIGH	ON								
	Inhibit Active LOW	OFF								
★	ENABLE INHIBIT-Sleep only									ON
★	5 second Timeout only									OFF
★	Normal (Note.2)			OFF	OFF					
	Mode 1 (Note.3)			OFF	ON					
	Mode 2 (Note.4)			ON	OFF					
	Mode 1 + 2 (Note.5)			ON	ON					
★	Pulse Mode	MDB Mode			ICT104V Mode					
	Credit-Pulse Normal HIGH	Scaling Factor (SF) = 100 Decimal Point Position (DPP) = 2			Connect with coin changer		ON			
	Credit-Pulse Normal LOW	Scaling Factor (SF) = 1 Decimal Point Position (DPP) = 0			Connect with ICT VCCS converter board		OFF			
★	Pulse Mode						ON			
	Other Mode						OFF			
★	Pulse Mode	Other Mode								
	1 pulse / € 5	MDB Mode							OFF	OFF
	5 pulses / € 5	Parallel A3 Mode							OFF	ON
	10 pulses / € 5	ICT104U Mode							ON	OFF
	25 pulses / € 5	ICT104V Mode							ON	ON

This dip switch is located on the CPU board, remove the CPU board cover first.

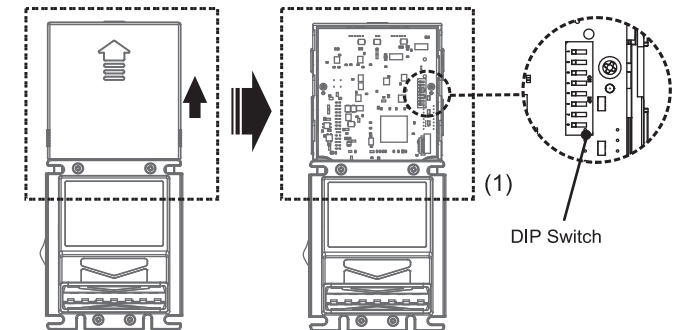

★ Manufacture setting

- Note :
1. After setting dip switch of the credit pulses, you should reset the bill acceptor again.
 2. Normal : No sleep function.
 3. Mode 1 : Bill-acceptor wakes up VMC with banknote only (special cable required).
 4. Mode 2 : VMC wakes up bill-acceptor.
 5. Mode 1+2 : Bill-acceptor wakes up with banknote or by VMC.
 6. Calibration card is not needed.